



SsangYong XLV
Standard Safety Equipment

2016



Adult Occupant



74%

Child Occupant



62%

Pedestrian



55%

Safety Assist



25%

SPECIFICATION

| | |
|-------------------------------|------------------------------|
| Tested Model | SsangYong Tivoli diesel, LHD |
| Body Type | - 5 door SUV |
| Year Of Publication | 2016 |
| Kerb Weight | 1435kg |
| VIN From Which Rating Applies | - all XLVs |
| Class | Small Family Car |

General comments

The SsangYong XLV is exactly the same as the SsangYong Tivoli apart from a slightly extended rear end. In terms of safety performance, the two cars are identical. The results presented here for the XLV are based on tests conducted on the better-selling Tivoli. The same scores and rating applies to both vehicles.

SAFETY EQUIPMENT

| | Driver | Passenger | Rear |
|---------------------------------|--------|-----------|------|
| FRONTAL CRASH PROTECTION | | | |
| Frontal airbag | ● | ● | ✗ |
| Belt pretensioner | ● | ● | ✗ |
| Belt loadlimiter | ● | ● | ● |
| Knee airbag | ○ | ✗ | ✗ |
| SIDE CRASH PROTECTION | | | |
| Side head airbag | ● | ● | ● |
| Side chest airbag | ● | ● | ✗ |
| Side pelvis airbag | ● | ● | ✗ |
| CHILD PROTECTION | | | |
| Isofix | — | ✗ | ● |
| Integrated CRS | — | ✗ | ✗ |
| Airbag cut-off switch | — | ● | — |
| SAFETY ASSIST | | | |
| Seat Belt Reminder | ● | ● | ● |
| OTHER SYSTEMS | | | |
| Active Bonnet (Hood) | ✗ | | |
| AEB City | ○ | | |
| AEB Inter-Urban | ○ | | |
| Speed Assistance System | ○ | | |
| Lane Assist System | ○ | | |

Note: Other equipment may be available on the vehicle but was not considered in the test year.

- Fitted to the vehicle as standard ○ Fitted to the vehicle as part of the safety pack
 ○ Not fitted to the test vehicle but available as option or as part of the safety pack ✗ Not available — Not applicable

ADULT OCCUPANT

Total 28.3 Pts / 74%

■ GOOD
 ■ ADEQUATE
 ■ MARGINAL
 ■ WEAK
 ■ POOR

Frontal Offset Deformable Barrier 6.6 Pts

Passenger Driver

Frontal Full Width 3.8 Pts

Rear Passenger Driver

Whiplash Rear Impact 2 Pts

Front seat Rear seat

Lateral Impact 15.9 Pts

Car Pole

AEB City 0

Performance:

 ADULT OCCUPANT

Total 28.3 Pts / 74%

Comments

The passenger compartment of the Tivoli remained stable in the offset deformable frontal impact. Dummy readings indicated good protection of the knees and femurs of the driver and passenger. SsangYong showed that a similar level of protection would be provided to occupants of different sizes and to those sat in different positions. Readings of chest compression indicated marginal protection of that body region. In the full-width rigid barrier test, protection of the driver was good except for the chest, protection of which was adequate. However, proper retention of the rear dummy failed, allowing excessive forward movement and protection of the head was rated as poor. As a result, the Tivoli lost all points for that dummy. SsangYong are investigating the cause of the failure. In the side barrier impact, the Tivoli scored maximum points with good protection of all critical body areas. Even in the more severe side pole test, protection of the chest was adequate and that of other critical body areas was good. Tests on the front seats and head restraints demonstrated good protection against whiplash injuries in the event of a rear-end collision. A geometric assessment of the rear seats indicated marginal whiplash protection. The Tivoli has an autonomous emergency braking system as part of its optional safety pack. The results of its assessment are not included in this rating.



CHILD OCCUPANT

Total 30.4 Pts / 62%

GOOD ADEQUATE MARGINAL WEAK POOR

Crash Test Performance based on 6 & 10 year old children

13.9 Pts

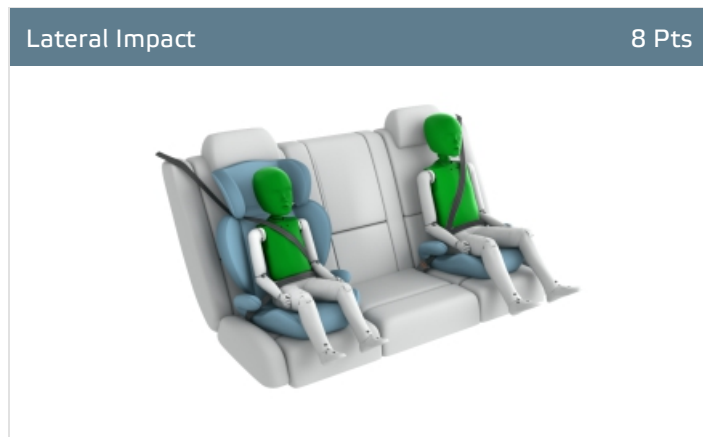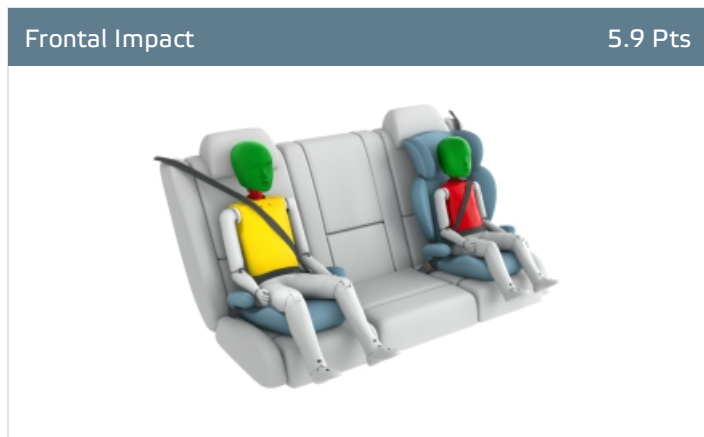

Restraint for 6 year old child: *Romer KidFix XP*
 Restraint for 10 year old child: *Graco Junior*

Safety Features

5 Pts

| | Front Passenger | 2nd row outboard | 2nd row center |
|----------------|-----------------|------------------|----------------|
| Isofix | ✗ | ● | ✗ |
| i-Size | ✗ | ● | ✗ |
| Integrated CRS | ✗ | ✗ | ✗ |

● Fitted to test car as standard ○ Not on test car but available as option ✗ Not available

CRS Installation Check

11.5 Pts

● Install without problem ○ Install with care ● Safety critical problem ✗ Installation not allowed

■ i-Size CRS



CHILD OCCUPANT

Total 30.4 Pts / 62%

■ **ISOFIX CRS**

Maxi Cosi Cabriofix & FamilyFix (ISOFIX)



BeSafe iZi Kid X3 ISOfix (ISOFIX)



Römer Duo Plus (ISOFIX)



Römer KidFix XP (ISOFIX)



■ **Universal Belted CRS**

Maxi Cosi Cabriofix (Belt)



Maxi Cosi Cabriofix & EasyBase2 (Belt)



Römer King II LS (Belt)



Römer KidFix XP (Belt)



CHILD OCCUPANT

Total 30.4 Pts / 62%

| | Seat Position | | | |
|---|---------------|---------|--------|-------|
| | Front | 2nd row | | |
| | PASSENGER | LEFT | CENTER | RIGHT |
| Maxi Cosi 2way Pearl & 2wayFix (rearward) (iSize) | □ | ● | □ | ● |
| Maxi Cosi 2way Pearl & 2wayFix (forward) (iSize) | □ | ● | □ | ● |
| BeSafe iZi Kid X1 i-Size (iSize) | □ | ● | □ | ● |
| Maxi Cosi Cabriofix & FamilyFix (ISOFIX) | □ | ● | □ | ● |
| BeSafe iZi Kid X3 ISOfix (ISOFIX) | □ | ● | □ | ● |
| Römer Duo Plus (ISOFIX) | □ | ● | □ | ● |
| Römer KidFix XP (ISOFIX) | □ | ● | □ | ● |
| Maxi Cosi Cabriofix (Belt) | ● | ● | ● | ● |
| Maxi Cosi Cabriofix & EasyBase2 (Belt) | ● | ● | ● | ● |
| Römer King II LS (Belt) | ● | ● | ● | ● |
| Römer KidFix XP (Belt) | ● | ● | ● | ● |

● Install without problem
 ● Install with care
 ● Safety critical problem
 ✘ Installation not allowed

Comments

In the frontal offset test, protection of the 10 year dummy's neck was rated as poor, based on dummy readings of neck tensile forces. Similarly, decelerations in the chest of the 6 year dummy indicated poor protection of this body region. In the side impact, both dummies were properly restrained and protected. The front passenger airbag can be disabled to allow a rearward facing child restraint to be used in that seating position. However, the information provided to the driver regarding the status of the airbag did not meet Euro NCAP's requirements and the system was not rewarded. All of the restraint types for which the Tivoli is designed could be properly installed and accommodated. The user manual states that the front passenger seat is not suitable for iSize restraints and the Tivoli lost points for those restraints in that seating position.

PEDESTRIAN PROTECTION

Total 23.2 Pts / 55%

■ GOOD
 ■ ADEQUATE
 ■ MARGINAL
 ■ WEAK
 ■ POOR

| | | | | | | | |
|-----------------------|---|-------------|----------|---------------|---------|------------|-------|
| Pedestrian Protection | 23.2 Pts | | | | | | |
| | <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="padding: 5px;">Head Impact</td> <td style="text-align: right; padding: 5px;">14.5 Pts</td> </tr> <tr> <td style="padding: 5px;">Pelvis Impact</td> <td style="text-align: right; padding: 5px;">2.7 Pts</td> </tr> <tr> <td style="padding: 5px;">Leg Impact</td> <td style="text-align: right; padding: 5px;">6 Pts</td> </tr> </table> | Head Impact | 14.5 Pts | Pelvis Impact | 2.7 Pts | Leg Impact | 6 Pts |
| Head Impact | 14.5 Pts | | | | | | |
| Pelvis Impact | 2.7 Pts | | | | | | |
| Leg Impact | 6 Pts | | | | | | |

AEB Pedestrian 0 Pts

Comments

The protection provided by the bonnet to a pedestrian's head was predominantly good or adequate, with poor results recorded only on the stiff windscreen pillars. The bumper scored maximum points for its protection of pedestrians' legs, with good results recorded at all test locations. However, the protection provided to the pelvis was more mixed, ranging from good to poor. The Tivoli has an autonomous emergency braking system as part of its optional safety pack. The results of its assessment are not included in this rating.

 SAFETY ASSIST

Total 3 Pts / 25%

GOOD
 ADEQUATE
 MARGINAL
 WEAK
 POOR

Speed Assistance

0 Pts

Seat Belt Reminder

3 Pts

| Applies To | All seats | | |
|------------|-------------|--------------------|-------------------|
| | Driver Seat | front passenger(s) | rear passenger(s) |
| Warning | | | |
| Visual | ● | ● | ● |
| Audible | ● | ● | ● |

● Pass
 ● Fail
 — Not available

Lane Support

0 Pts

| | |
|-----------------------|--------|
| System Name | 0 |
| Operational From | 0 km/h |
| Warning | 0 |
| PERFORMANCE | |
| LDW Confirmation Test | Fail |



SAFETY ASSIST

Total 3 Pts / 25%

Comments

The Tivoli has, as standard, a seatbelt reminder for the front and rear seats. Autonomous emergency braking is part of the optional safety pack and operates at highway speeds. The results of its assessment are not included in this rating.